MEDALLION METALS

LIMITED

ASX ANNOUNCEMENT



28 March 2022 ASX:MM8

Conventional Process to Yield High Gold and Copper Recoveries at Ravensthorpe Gold Project

Key Points

- GR Engineering Services Limited (GRES, ASX: GNG) confirms consistent, high metallurgical recoveries achievable for gold, copper and silver by industry standard process route for Ravensthorpe Gold Project ores
- Extensive metallurgical testwork programmes inform GRES findings
- Gravity-Flotation-Carbon in Leach (CIL) preferred process route to produce gold dore and copper/precious metal concentrates
- Overall RGP metal recovery to saleable product estimated as follows;

Gold (Au): 94.6%
 Copper (Cu): 86.1%
 Silver (Ag): 73.3%

High copper and silver recoveries to enhance RGP economics

Medallion Metals Limited (ASX:MM8, the Company or Medallion) provides the following update in relation to ongoing metallurgical studies at the Company's flagship Ravensthorpe Gold Project (RGP or Project).

Managing Director, Paul Bennett, commented:

"The completion of the metallurgy review is an important step for Medallion to both consolidate the significant amount of work done, and to plan for the future. We're pleased to have an industry leader in GR Engineering assist us in this regard. The outcomes of their work demonstrates high gold and copper recoveries can be consistently achieved using industry standard processes across lithologies and deposits which has the potential to improve Project returns by unlocking the value of the by-products. The review findings will assist us in planning the next and final round of metallurgical testwork for RGP, in addition to supporting the upcoming resource update expected in April."

Scope of Review

Medallion engaged GRES to undertake a review of all metallurgical testwork undertaken on RGP ores¹. This testwork provided a substantial database for the GRES metallurgical review. The review was tasked to confirm the preferred process route to maximise gold, copper and silver recovery from RGP ores. Estimates of metal recoveries, concentrate grades and reagent consumptions under the preferred process route are other key

¹ For further information about RGP historical testwork and the background to the GRES review, please refer to the Company's ASX announcement dated 13 October 2021.

Medallion Metals Limited

outcomes of the review. The scope also included a gap analysis to identify any additional metallurgical testwork which may be required to support a Definitive Feasibility Study (DFS) level of assessment of the technical and commercial viability of RGP in the future.

Summary Findings

GRES concluded that an industry standard gravity-flotation-leach process route is the preferred option to maximise gold, copper and silver recovery from RGP ores to saleable products, in the form of gold dore and copper/precious metal concentrates. Estimates of metal recoveries and deportment to saleable products are provided in Table 1.

	Dore (%)	Concentrate (%)	Total (%)
Gold	62.8	31.7	94.6
Copper	-	86.1	86.1
Silver	28.6	44.8	73.3

Table 1: Forecast recoveries to saleable products

Sequential flotation and leach processing is a widely used and conventional process route utilised globally for the processing of gold ore bodies which contain significant copper and silver by-product credits, in Australia of note this includes the Deflector project owned and operated by Silver Lake Resources Limited. Low copper ore from the oxide and transitional zones will by-pass the flotation stage and progress to direct leaching following the gravity concentration stage.

GRES recommended additional testwork be performed to confirm the potential for use of a coarser grind size and to ensure representivity from areas of expected resource growth in future metallurgical testwork performed.

Next Steps

As a result of the GRES review confirming the potential for high recoveries of gold, copper and silver to saleable products, Medallion will estimate gold, copper and silver as part of the Mineral Resource Estimate (MRE) update for RGP. The MRE update is expected to be announced in April 2022. While gold is the dominant driver of Project economics, unlocking the value of copper as a significant by-product credit has the potential to materially enhance Project returns.

The Company has commenced a sighter round of exhaustive leach tests on 19 samples from the Gem Restored deposit and the Ariel and Meridian prospects. Preparations are also underway for the collection of samples for the additional test work recommended by GRES.

Further information regarding the GRES review and findings is provided at Appendix 1 of this announcement.

This announcement is authorised for release by the Board of Medallion Metals Limited.

-ENDS-

For further information, please visit the Company's website www.medallionmetals.com.au or contact:

Paul Bennett
Managing Director
Medallion Metals Limited
Phone: +61 8 6424 8700

Email: info@medallionmetals.com.au

Suite 1, 11 Ventnor Avenue, West Perth WA 6005



DISCLAIMER

References in this announcement may have been made to certain ASX announcements, including exploration results, Mineral Resources and Ore Reserves. For full details, refer said announcement on said date. The Company is not aware of any new information or data that materially affects this information. Other than as specified in this announcement and mentioned announcements, the Company confirms it is not aware of any new information or data that materially affects the information included in the original market announcement(s), and in the case of estimates of Mineral Resources and Ore Reserves, that all material assumptions and technical parameters underpinning the estimates in the relevant announcement continue to apply and have not materially changed. The Company confirms that the form and context in which the Competent Person's findings are presented have not been materially modified from the original announcement.

COMPETENT PERSONS STATEMENT

The information in this announcement that relates to exploration results is based on information compiled by Mr Paul Bennett, a Competent Person who is a Member the Australasian Institute of Mining and Metallurgy ("AusIMM") (201424). Mr Bennett is a director of the Company and has sufficient experience that is relevant to the style of mineralisation and type of deposit under consideration and to the activity being undertaken to qualify as a Competent Person as defined in the 2012 Edition of the 'Australasian Code for Reporting of Mineral Resources and Ore Reserves' (the "JORC Code"). Mr Bennett consents to the inclusion in the report of the matters based on his information in the form and context in which it appears.

FORWARD LOOKING STATEMENTS

This announcement may contain forward-looking information about the Company and its operations. In certain cases, forward-looking information may be identified by such terms as "anticipates", "believes", "should", "could", "estimates", "target", "likely", "plan", "expects", "may", "intend", "shall", "will", or "would". These statements are based on information currently available to the Company and the Company provides no assurance that actual results will meet management's expectations. Forward-looking statements are subject to risk factors associated with the Company's business, many of which are beyond the control of the Company. It is believed that the expectations reflected in these statements are reasonable but they may be affected by a variety of variables and changes in underlying assumptions which could cause actual results or trends to differ materially from those expressed or implied in such statements. There can be no assurance that actual outcomes will not differ materially from these statements.

APPENDIX 1

Historical Testwork Summary

Three substantial phases of metallurgical testwork have been undertaken on RGP ores, the first in 2005, followed by more recent programmes in 2018 & 2019 (Table 2). Drill holes sampled to form metallurgical testwork composites are shown in Figure 1, with collar details provided as Annexure 1 and sampling details provided as Annexure 2. The samples are a representative spread across the lithologies and deposits that comprise the Company's current MRE.

Testwork programme	2005	2018	2019
Laboratory	Ammtec/IML/Optimet	ALS	Bureau Veritas
Aggregate sample	1,613kg	658kg	306kg

Table 2: Laboratory & sample mass submitted for historical RGP metallurgical testwork programmes

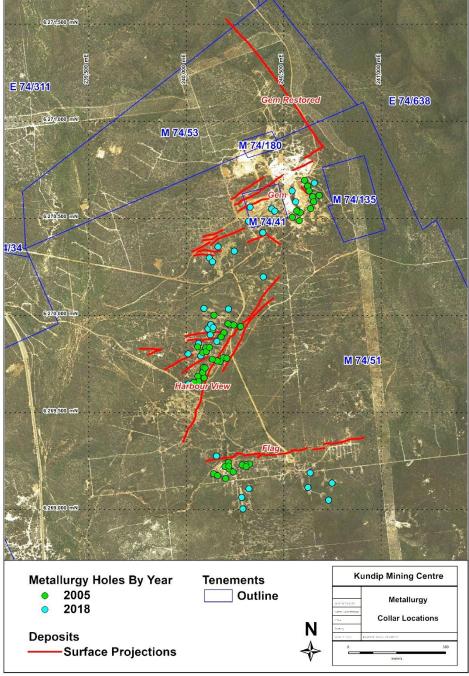


Figure 1: Collar locations for drill holes used in 2005, 2018 and 2019 metallurgical testwork

Process Route Selection

The extraction of gold by cyanidation from RGP deposits will be influenced by the presence of cyanide soluble copper present mainly in the transitional weathering profile. Secondary copper minerals which are a product of the weathering process of chalcopyrite, the dominant primary copper mineral at RGP, have the potential to increase operating costs due to the consumption of sodium cyanide and the subsequent destruction of cyanide in leach tailing prior to discharge to tailings storage.

The 2020 Feasibility Study² (FS) mill feed schedule broken down by weathering profile and high/low copper is shown in Table 3. Transition ore comprises approximately 11% of the current mill feed schedule. Other material types are considered low risk with respect to copper interference due to low overall copper grades (oxide) or low levels of soluble copper (sulphide). The proportion of transition ore as part of the overall processing schedule is expected to diminish over time as the resource grows at depth with the addition of sulphide material and regionally with the potential addition of oxide and sulphide discoveries.

		Oxide Low Cu	Oxide High Cu	Transition Low Cu	Transition High Cu	Sulphide Low Cu	Sulphide High Cu
Tonnes	t	591,321	800,936	167,482	299,179	331,497	2,170,292
Au	g/t	0.94	1.94	0.91	2.43	0.94	3.30
Ag	g/t	0.77	1.01	1.09	2.17	1.12	3.15
Cu	%	0.04	0.08	0.06	0.21	0.08	0.40

Total
4,360,708
2.40
2.13
0.24

Proportion of FS mill feed by tonnes, gold and copper metal							
Tonnes	%	13.6	18.4	3.8	6.9	7.6	49.8
Au metal	%t	5.3	14.9	1.5	6.9	3.0	68.4
Cu metal	%	2.5	6.3	1.0	6.0	2.6	81.6

Table 3: RGP FS (June 2020) mill feed schedule by weathering profile and high/low copper (0.4% Cu threshold)

When taking into consideration test work results and factoring for operational considerations and cost, GRES has recommended a strategy to apply leaching to low copper (<0.4% Cu) oxide and transition ores and incorporate flotation (ahead of leaching) for all high copper and sulphide ores. The proposed process flow for RGP is shown as a block diagram in Figure 2 below.

Ore segregation (by weathering profile and copper grade) through ongoing grade control practices at the mining stage will be necessary to enable management of mill feed scheduling and blending.

Gravity recovery of gold will be applied for all ore types. Low copper oxide and transition ore will by-pass flotation to direct leach to produce dore. All other material types will be subject to flotation to recover a copper/precious metal concentrate followed by leaching of the flotation tail to produce dore. A tailing detoxification process (ReCYN) using resin will be applied to recover and recycle cyanide. This process is also expected to yield relatively small amounts of copper precipitate. Cyanide consumption at the leach stage is estimated at 1.65 kg per tonne of ore processed basis the FS mill feed schedule. Cyanide consumption rates will change as the composition of the mill feed schedule changes with expected growth in resources.

The significant bank of historical test work demonstrates consistently high recoveries of gold, copper and silver from RGP ores can be achieved through the application of these industry standard process routes. Further test work will be required to inform and optimise engineering designs.

² Refer to the Company's Prospectus announced on the ASX on 18 March 2021 for further details regarding the FS.



RGP – PROCESS FLOW

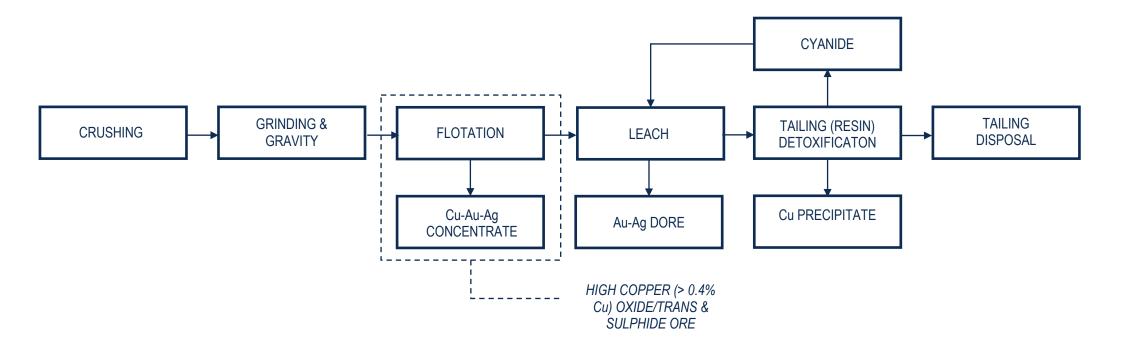


Figure 2: KMC process flow block diagram

Metallurgical Recovery

Extensive test work has been carried out in development of the processing routes for the KMC ores. Recoveries associated with each of the processes, where tested, and for each of the ore types, is provided in Table 4.

Parameter	Unit	Oxide Low Cu	Oxide High Cu	Transition Low Cu	Transition High Cu	Sulphide Low Cu	Sulphide High Cu
Gravity extracted – Au	%	24.1	29.0	38.6	38.6	38.6	38.6
Gravity extracted – Ag	%	30.0	30.0	30.0	20.0	15.0	25.0
Recovery to Flot Conc – Au	%		35.0		25.0	52.6	63.6
Recovery to Flot Conc – Ag	%		30.0		5.0	52.2	74.2
Recovery to Flot Conc – Cu	%		30.0		45.0	81.6	92.1
Conc grade – Au	g/t		137		60	63	39
Conc grade – Ag	g/t		63		13	81.6	31
Conc grade – Cu	%		22.9		22.8	17.3	23.3
Recovered to dore - Au (grav + leach)	%	91.8	69.6	93.4	79.6	65.2	56.6
Recovered to dore - Ag (grav + leach)	%	55.6	39.0	71.1	72.7	33.2	20.0
ReCYN precipitation - Cu	%	22.9	16.0	22.9	12.6	4.6	2.0
Overall recovery							
Gold	%	91.8	94.1	93.4	94.6	96.8	94.8
Silver	%	55.6	60.0	71.1	76.7	77.6	75.6
Copper	%	22.9	46.0	22.9	57.6	86.2	94.0

Table 4: Metal recovery by process stage and material type

Applying the GRES estimated recoveries to each material type from the FS mill feed schedule (Table 2) yields the overall recoveries shown in Table 5.

Metal	Recovery (%)
Gold	94.6
Silver	73.3
Copper	86.1

Table 5: Overall metal recovery

The overall metal recovery estimate is specific to the FS mill feed schedule. It is expected that as the resource grows and new mine plans are optimised, the overall recovery will likely improve as more sulphide material is added to the MRE.

Concentrate marketing

GRES has estimated that flotation concentrate grades will be in excess of 20% for copper and 39g/t for gold. As part of the 2018 metallurgical testwork programme, a bulk fresh flotation test was undertaken on a 59kg sample of KMC ore under optimised flotation conditions. The flotation test yielded 3.1kg of concentrate grading 53.6g/t Au and 19.3% Cu (gold and copper recovery to concentrate 67.6% and 90.7% respectively). An extended assay suite was undertaken on a sub-sample of the bulk flotation concentrate. This assay suite was conducted to identify the contained levels of analytes that may incur penalties for sale.

All analytes were significantly less than penalty levels. A summary of potential penalty analytes and their values is provided in Table 6 below.

BULK FRESH CONCENTRATE ASSAY: SUMMARY OF RESULTS							
Analyte	Analyte Penalty Level						
As	2,000 ppm	190 ppm					
Bi	500 ppm	30 ppm					
Cd	300 ppm	10 ppm					
Cl	0.05 %	0.01 %					
Co - Ni	F 000 mm	Co: 1,190 ppm					
Co + Ni	5,000 ppm	Ni: 270 ppm					
F	300 ppm	50 ppm					
Hg	10 ppm	0.6 ppm					
Pb	30,000 ppm	2,160 ppm					
Sb	2,000 ppm	2.5 ppm					
Zn	30,000 ppm	4,600 ppm					

Table 6: Bulk fresh concentrate penalty analytes

Penalty analytes and their values were provided by Cliveden Trading AG (Cliveden) who were engaged by the Company to undertake a concentrate marketing analysis. Cliveden reported that the KMC concentrate would be attractive to smelters that primarily seek copper concentrate (as opposed to gold roasters) and are efficient in their recovery of precious metals in their smelting and refining processes. Cliveden's estimate of payment terms (high-low range) is provided in Table 7.

Element	Sale Terms	Recommended Low	Recommended High	
Cu	Payable % 96.5		96.5	
Au	Payable %	97.0	98.25	
	Minimum deduction (g/t)	1.0	1.0	
Ag	Payable %	90	90	
	Minimum deduction (g/t)	0	0	

Table 7: Recommended payment terms

Future testwork

As part of the historical testwork review, GRES has recommended additional metallurgical testwork required to both support a DFS level of assessment of the Project's technical and commercial viability and to optimise recoveries.

The inclusion of the flotation stage warrants additional test work to determine performance at a grind size of P80 106 μ m. The ability to maintain flotation performance at a larger grind size (historical testwork undertaken at P80 75 μ m) would provide an opportunity to reduce capital cost through selection of a single stage SAG mill as opposed to a two-stage grind.

Sample selection for future testwork should also give consideration to spatial representivity as material changes in the resource from new deposits or growth of existing resources at depth and along strike will require the areas of growth to be represented in testwork.



ANNEXURE 1: Metallurgical Testwork Drill Hole Collar Table (Grid ID: MGA2020_51)

DODSKP005 HARBOUR VIEW RCIDDH 246.7 2003 240142 6270002 15.77 ~70.0 99	Hole ID	Prospect	Hole Type	Depth (m)	Year	Easting	Northing	RL	Dip (°)	Azimuth
DODGKP029	DD03KP005							157.7		99
DODSKP098 MARBOUR VIEW RCIDDH 180.1 2003 240137 8269672 157.4 6-10 104							<u> </u>			
DODGKP089										
DODGKP900										
DOUGNEPOST HARBOUR VIEW RCDDH 120.3 2003 240075 6289792 156.6 60.0 105										
DODSKP902 HARBOUR VIEW RC/DDH 60.0 20.3 240088 8269732 157.9 60.0 104				<u>. </u>						
DODGKP432										
DOBSKP432							6269784			
DDDSKP472	DD05KP432	FLAG	RC/DDH	165.6	2005	240284	6269064	149.9	-65.0	352
DD08KP500 HARBOUR VIEW RCIDDH 121.5 2005 240333 6270426 177.2 -58.0 331	DD05KP433	FLAG		<u>. </u>	2005	240321	6269108	151.3	-65.0	351
DD08KP500 HARBOUR VIEW RCIDDH 186.5 2008 240216 6270034 159.7 60.0 101	DD05KP472	FLAG	RC/DDH	257.3	2005	240747	6269138	159.8	-70.0	350
DDB8KP512 GEM RC/DDH 210.7 2008 240439 6270549 190.4 -60.0 290 DDB8KP512 HARBOUR VIEW RC/DDH 210.7 2008 240636 6269957 152.6 -60.0 93 30 30 30 30 30 30 3	DD05KP473	GEM	RC/DDH	121.5	2005	240393	6270426	177.2	-58.0	331
DD08KP512	DD08KP500	HARBOUR VIEW	RC/DDH	185.5	2008	240216	6270034	159.7	-60.0	101
DD08KPF20	DD08KP510	GEM	RC/DDH	86.0	2008	240439	6270549	190.4	-60.0	290
DDD9KP710 GEM	DD08KP512	HARBOUR VIEW	RC/DDH	210.7	2008	240063	6269857	152.6	-60.0	93
DDD9KP742	DD08KP520	FLAG	RC/DDH	180.3	2008	240636	6269190	166.7	-73.0	16
DDD9KP751 GEM	DD09KP710	GEM	RC/DDH	118.4	2009	240454	6270537	189.4	-88.5	118
DD10KP720	DD09KP742	HARBOUR VIEW	RC/DDH	120.0	2009	240222	6269952	163.6	-61.0	104
DD10KP731	DD09KP751	GEM	DDH	55.9	2009	240118	6270296	168.9	-55.5	349
DD10KP736	DD10KP720	HARBOUR VIEW	RC/DDH	311.4	2010	240091	6270037	154.1	-60.2	102
DD10KP739	DD10KP731	HARBOUR VIEW	RC/DDH	135.2	2010	240157	6269867	157.4	-52.0	105
DD10KP787	DD10KP736	HARBOUR VIEW	RC/DDH	228.1	2010	240009	6269803	155.4	-60.3	104
DD10KP804	DD10KP739	HARBOUR VIEW			2010	240010		155.9	-67.6	107
DD10KP810	DD10KP787	FLAG	DDH	60.1	2010		6269276	145.8	-56.5	173
DD17KP861 GEM DDH 140.9 2017 240135 6270277 165.6 -59.9 352 DD17KP862 GEM DDH 78.7 2017 240163 6270354 173.0 -70.3 354 DD17KP863 GEM DDH 125.0 2017 240247 6270332 166.8 -60.6 353 DD17KP864 GEM DDH 102.5 2017 240320 6270486 185.3 -60.0 337 DD17KP865 GEM DDH 57.0 2017 240328 6270558 185.2 -69.9 334 DD17KP865 GEM DDH 249.5 2017 240328 6269901 151.9 -65.2 102 DD17KP866 GEM DDH 122.3 2017 240561 6270586 194.3 -65.2 102 DD17KP868 GEM DDH 122.3 2017 240561 6270586 194.3 -70.2 126 DD17KP869 GEM DDH 111.4 2017 240643 6270642 198.3 -70.2 126 DD17KP870 GEM DDH 75.5 2017 240567 6270682 199.3 -60.0 293 DD17KP873 HARBOUR VIEW DDH 219.1 2017 240138 6269939 159.9 -59.8 98 RC03KP045 HARBOUR VIEW RC 118.0 2003 240179 6269889 159.7 -60.0 104 RC03KP055 HARBOUR VIEW RC 118.0 2003 240179 6269889 161.1 -60.0 104 RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 70.0 2003 240174 6269967 159.8 -60.0 104 RC03KP056 HARBOUR VIEW RC 70.0 2003 240179 6269767 159.8 -60.0 104 RC03KP059 HARBOUR VIEW RC 70.0 2003 240179 6269767 159.8 -60.0 104 RC03KP069 HARBOUR VIEW RC 70.0 2003 240179 6269767 159.8 -60.0 104 RC03KP069 HARBOUR VIEW RC 70.0 2003 240060 6269667 159.8 -60.0 104 RC03KP069 HARBOUR VIEW RC 50.0 2003 240060 6269667 158.7 -60.0 104 RC03KP069 HARBOUR VIEW RC 50.0 2003 240060 6269667 158.7 -60.0 104 RC03KP070 HARBOUR VIEW RC 50.0 2003 240084 6269950 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269970 158.4 -60.0 104 RC03KP073 HARBOUR VIEW	DD10KP804									
DD17KP862 GEM DDH 78.7 2017 240163 6270354 173.0 -70.3 354										
DD17KP863 GEM DDH 125.0 2017 240247 6270332 166.8 -60.6 353 DD17KP864 GEM DDH 102.5 2017 240320 6270486 185.3 -60.0 337 DD17KP865 GEM DDH 57.0 2017 240328 6270558 185.2 -69.9 334 DD17KP866 HARBOUR VIEW DDH 249.5 2017 240328 6270558 185.2 -69.9 334 DD17KP866 GEM DDH 122.3 2017 240561 6270566 194.3 -83.3 30 DD17KP869 GEM DDH 111.4 2017 240543 6270642 198.3 -70.2 126 DD17KP870 GEM DDH 75.5 2017 240567 6270682 199.3 -60.0 293 DD17KP873 HARBOUR VIEW DDH 219.1 2017 240138 6269991 151.9 -55.0 104 RC03KP046 HARBOUR VIEW RC 118.0 2003 240194 6269911 161.5 -55.0 104 RC03KP055 HARBOUR VIEW RC 118.0 2003 240179 6269889 159.7 -60.0 104 RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240156 6269767 159.8 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240156 6269767 159.8 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240156 6269767 159.8 -60.0 104 RC03KP056 HARBOUR VIEW RC 70.0 2003 240160 6269667 158.1 -60.0 104 RC03KP056 HARBOUR VIEW RC 70.0 2003 240164 6269951 165.2 -66.0 104 RC03KP056 HARBOUR VIEW RC 106.0 2003 240164 6269966 158.1 -60.0 104 RC03KP066 HARBOUR VIEW RC 100.0 2003 240064 6269660 158.1 -60.0 104 RC03KP069 HARBOUR VIEW RC 50.0 2003 240064 6269660 158.1 -60.0 104 RC03KP076 HARBOUR VIEW RC 50.0 2003 240064 6269660 158.1 -60.0 104 RC03KP076 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.1 -60.0 104 RC03KP076 HARBOUR VIEW RC 50.0 2003 240084 6269967 158.7 -60.0 104 RC03KP076 HARBOUR VIEW RC 50.0 2003 240084 6269968 162.9 -60.0										
DD17KP864 GEM DDH 102.5 2017 240320 6270486 185.3 -60.0 337										
DD17KP865 GEM DDH 57.0 2017 240328 6270558 185.2 -69.9 334										
DD17KP867										
DD17KP868										
DD17KP869 GEM DDH 111.4 2017 240543 6270642 198.3 -70.2 126										
DD17KP870 GEM DDH 75.5 2017 240657 6270682 199.3 -60.0 293				•						
DD17KP873										
RC03KP045 HARBOUR VIEW RC 118.0 2003 240194 6269911 161.5 -55.0 104 RC03KP046 HARBOUR VIEW RC 118.0 2003 240179 6269889 159.7 -60.0 104 RC03KP053 HARBOUR VIEW RC 22.0 2003 240208 6269780 161.1 -60.0 104 RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240159 6269767 159.8 -60.0 104 RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269961 165.2 -66.0 104										
RC03KP046 HARBOUR VIEW RC 118.0 2003 240179 6269889 159.7 -60.0 104 RC03KP053 HARBOUR VIEW RC 22.0 2003 240208 6269780 161.1 -60.0 104 RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240159 6269767 159.8 -60.0 104 RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104		·							ii .	
RC03KP053 HARBOUR VIEW RC 22.0 2003 240208 6269780 161.1 -60.0 104 RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240159 6269767 159.8 -60.0 104 RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240092 6269679 158.7 -60.0 104										
RC03KP055 HARBOUR VIEW RC 58.0 2003 240174 6269763 160.2 -60.0 104 RC03KP056 HARBOUR VIEW RC 76.0 2003 240159 6269767 159.8 -60.0 104 RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240097 6269706 158.4 -60.0 104										
RC03KP056 HARBOUR VIEW RC 76.0 2003 240159 6269767 159.8 -60.0 104 RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104				•						
RC03KP058 HARBOUR VIEW RC 70.0 2003 240060 6269687 158.1 -60.0 104 RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269561 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 62699730 158.2 -60.0 104										
RC03KP059 HARBOUR VIEW RC 106.0 2003 240133 6269774 158.7 -55.0 104 RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP100 HARBOUR VIEW RC 70.0 2003 24024 6269641 156.5 -60.0 104 <				-						
RC03KP064 HARBOUR VIEW RC 100.0 2003 240244 6269951 165.2 -66.0 104 RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104										
RC03KP069 HARBOUR VIEW RC 52.0 2003 240064 6269660 158.1 -60.0 104 RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269958 162.9 -60.0 104				•						
RC03KP070 HARBOUR VIEW RC 25.0 2003 240092 6269679 158.7 -60.0 104 RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269958 162.9 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294				-						
RC03KP073 HARBOUR VIEW RC 50.0 2003 240084 6269706 158.4 -60.0 104 RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269958 162.9 -60.0 104 RC04KP104 HARBOUR VIEW RC 135.0 2003 240084 6269958 162.9 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294				•						
RC03KP075 HARBOUR VIEW RC 46.0 2003 240097 6269730 158.2 -60.0 104 RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269958 162.9 -60.0 104 RC04KP118 GEM RC 85.0 2003 240084 6269809 154.3 -60.0 104 RC04KP120 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296										
RC03KP085 HARBOUR VIEW RC 58.0 2003 240279 6269943 167.9 -60.0 104 RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269809 154.3 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294				-						
RC03KP098 HARBOUR VIEW RC 70.0 2003 240036 6269641 156.5 -60.0 104 RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269809 154.3 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294				•						
RC03KP100 HARBOUR VIEW RC 135.0 2003 240214 6269958 162.9 -60.0 104 RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269809 154.3 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294										
RC03KP104 HARBOUR VIEW RC 135.0 2003 240084 6269809 154.3 -60.0 104 RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294				-						
RC04KP118 GEM RC 85.0 2004 240623 6270666 199.2 -60.0 294 RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294										
RC04KP120 GEM RC 82.0 2004 240630 6270642 197.2 -59.0 296 RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294										
RC04KP122 GEM RC 124.0 2004 240585 6270530 184.7 -61.0 294 RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294				•						
RC04KP126 GEM RC 80.0 2004 240607 6270696 203.6 -50.0 294										
	RC04KP127	GEM	RC	95.0	2004	240648	6270612	193.8	-50.0	



RC04KP130	GEM	RC	85.0	2004	240682	6270618	193.5	-70.0	294
RC04KP132	GEM	RC	100.0	2004	240653	6270587	190.6	-60.0	294
RC04KP134	GEM	RC	136.0	2004	240638	6270551	186.3	-60.0	294
RC04KP147	FLAG	RC	45.0	2004	240325	6269235	152.6	-60.0	354
RC04KP148	FLAG	RC	45.0	2004	240306	6269232	151.1	-60.0	354
RC04KP149	FLAG	RC	45.0	2004	240286	6269231	148.8	-60.0	354
RC04KP155	FLAG	RC	25.0	2004	240216	6269244	142.6	-60.0	354
RC04KP156	FLAG	RC	55.0	2004	240219	6269210	144.5	-60.0	354
RC04KP159	FLAG	RC	40.0	2004	240198	6269222	144.3	-60.0	354
RC04KP163	FLAG	RC	63.0	2004	240140	6269185	140.3	-60.0	354
RC04KP168	GEM	RC	130.0	2004	240567	6270538	186.6	-60.0	294
RC04KP173	GEM	RC	148.0	2004	240544	6270506	183.6	-60.0	294
RC04KP175	GEM	RC	142.0	2004	240580	6270488	181.0	-60.0	294
RC04KP182	HARBOUR VIEW	RC	76.0	2004	240059	6269839	153.5	-60.0	354
RC04KP187	HARBOUR VIEW	RC	87.0	2004	240100	6269834	155.6	-60.0	354
RC04KP188	HARBOUR VIEW	RC	99.0	2004	240102	6269814	156.6	-60.0	354
RC04KP189	HARBOUR VIEW	RC	87.0	2004	240119	6269836	155.8	-60.0	354
RC04KP193	HARBOUR VIEW	RC	64.0	2004	240039	6269656	157.4	-60.0	354
RC04KP197	FLAG	RC	52.0	2004	240307	6269222	151.6	-60.0	354
RC04KP198	FLAG	RC	52.0	2004	240218	6269225	144.8	-60.0	354
RC04KP200	FLAG	RC	64.0	2004	240240	6269195	145.8	-60.0	354
RC04KP201	FLAG	RC	76.0	2004	240202	6269161	144.6	-60.0	354
RC04KP204	FLAG	RC	64.0	2004	240161	6269176	141.8	-72.0	354
RC06KP475	FLAG	RC	196.0	2006	240291	6269004	147.2	-60.0	354
RC10KP781	HARBOUR VIEW	RC	174.0	2010	240395	6270199	166.6	-59.7	106



ANNEXURE 2: Metallurgical Testwork Drilling JORC Table 1

Section 1, Sampling Techniques and Data

Criteria	JORC Code explanation	Commentary
Sampling	Nature and quality of sampling (e.g., cut channels,	Historical exploration at Kundip prior to 1997
Criteria Sampling techniques	Nature and quality of sampling (e.g., cut channels, random chips, or specific specialised industry standard measurement tools appropriate to the minerals under investigation, such as down hole gamma sondes, or handheld XRF instruments, etc.). These examples should not be taken as limiting the broad meaning of sampling. Include reference to measures taken to ensure sample representivity and the appropriate calibration of any measurement tools or systems used. Aspects of the determination of mineralisation that are Material to the Public Report. In cases where 'industry standard' work has been done this would be relatively simple (e.g., 'reverse circulation drilling was used to obtain 1 m samples from which 3 kg was pulverised to produce a 30 g charge for fire assay'). In other cases, more explanation may be required, such as where there is coarse gold that has inherent sampling problems. Unusual commodities or mineralisation types (e.g., submarine nodules) may warrant disclosure of detailed information.	 Historical exploration at Kundip prior to 1997 included (REVERSE CIRCULATION) RCP, DIAMOND CORE (DD), Underground diamond core drill holes (UGDD), Aircore (AC), Percussion Rotary Air Blast (RAB) and Vacuum drill holes for a combined total of 1,640 drill holes for 59,901m. Medallion has completed a full database validation on the nature and quality of the sampling undertaken and has determined that there is a lack of detailed information available pertaining to the equipment used, orientation methods, sample techniques, sample sizes, sample preparation and assaying methodologies utilised to generate these datasets. Downhole surveying of the drilling where documented has been undertaken using Eastman single. Drilling completed during 1997 and 2016 at Kundip was completed by Tectonic Resources (TTR) and Silver Lake Resources (SLR), they followed protocols and QAQC procedures as per industry best practice at the time. Drill holes were sampled using diamond core drill holes (DD), Reverse Circulation (RCP), for a total of 1,784 drill holes for 114,156.50m. Drilling has been completed on nominal spacing of 40m x 20m spacings. Downhole surveying of the drilling where documented has been undertaken using Eastman single and REFLEX EZ-SHOT. In 2017 Medallion completed 14 diamond core drill holes for 1,945m. In 2018, Medallion completed RCP (32 for 2,679.4m), DD (13 "tails" for 1,424.27m) and AC (77 for 3,745m). Diamond core holes were drilled predominantly with HQ/NQ with minor PQ. Sampling was geologically defined and followed protocols and QAQC procedures as per industry best practice. Downhole surveying of the drilling has been undertaken using REFLEX EZY-SHOT and north seeking gyro tool. Historical sampling used half-core (BQ & NQ) marked up for assay at a maximum interval of 1m constrained by geological boundaries. Minimum samples <30cm exist and there is a lack of detailed information available pertaining to equipment used and orientation methods for structural rea
		maximum sample interval of 1m constrained by geological boundaries. Drill core is sampled from same side of core when cut in half by a diamond core saw and half HQ and NQ core samples submitted for assay analysis. All Diamond core is
		stored in industry standard core trays and racks and is labelled with the drill hole ID and core

		intervals. • Medallion - DD were drilled with PQ, HQ and NQ All core is orientated, and structural readings obtained using a Kenometer Core Orientation tool logged geologically, and marked up for assay at a maximum sample interval of 1m constrained by geological boundaries. Drill core is sampled from same side of core when cut in half by a diamond core saw and half PQ, HQ and NQ core samples submitted for assay analysis. In intervals of un orientated core, the same half of the core has
		been sampled where possible, by extending a culine from orientated intervals through into the un orientated intervals. The lack of a consisten geological reference plane, (such as bedding o foliation), precludes using geological features to orient the core. All Diamond core is stored in industry standard core trays and racks and is labelled with the drill hole ID and core intervals and have been reviewed by the Competent Person. RCP, AC and RAB sampling methodology has changed over time. Sample collection prior to 2007 was via a cyclone, dust collection system and multi-stage riffle splitter attached to the drill rig. From the beginning of 2008, sample collection was via a cyclone, dust collection system and cone splitter attached to the drill rig. Barren zones were composite sampled (2-4m) with anomalous zones re-split into 1m samples. RCP chips were routinely collected in chip box trays at 1m intervals where it was geologically logged, and sample intervals determined. All chip box trays have been reviewed by the Competent Person. It is the Competent Person's opinion that sample representivity of drilling at Kundip is of a good
Drilling techniques	Drill type (e.g., core, reverse circulation, open-hole hammer, rotary air blast, auger, Bangka, sonic, etc) and details (e.g., core diameter, triple or standard tube, depth of diamond tails, face-sampling bit or other type, whether core is oriented and if so, by what method, etc).	 Historically drilling is a combination of RAB, AC Vacuum, RCP, DD, and underground DD. Details for hole diameter and bit types for RAB, AC and Vacuum drilling is generally unknown. Reverse Circulation drilling has been utilised to an average depth of 76m and as pre-collars to diamond core holes. Reverse Circulation drilling has been via face sampling hammer with a hole diamete approximately 5 ½ inch. DD core diameter is dominantly a combination of HQ3/NQ2 with limited PQ. 2003 (TTR): 15 DD's for 688.4m of NQ2 coring and 133.3m of HQ and HQ triple tube coring orientated core. 95 RCP drill holes including pre collars to DDH's for 10,465m was undertaken by Resource Drilling utilising a 5 1/2-inch drill bit Downhole surveys were taken with an Eastman survey camera. Diamond core was orientated using an EzyMark™ method with core reconstructed in an angle iron cradle. 2004 (TTR): 5 DD's for 531m, HQ3. 231 RCP dril holes for a total of 19,553.5m was undertaken by Resource Drilling utilising a 5 1/2-inch hammer bit Downhole surveys were taken with an Eastman survey camera. Diamond core was orientated using an EzyMark™ method with core

- reconstructed in an angle iron cradle.
- 2005 (TTR): 7 DD's for 470.3m completed by Layne Drilling. Core diameter collared with HQ3 changing to NQ2 in competent rock. All core was orientated. 101 RCP drill holes for a total of 10,401m was undertaken by Arrinooka utilising a 5 1/2-inch drill bit. Downhole surveys were taken with a FlexIT single-shot survey camera. Diamond core was orientated using an EzyMark™ method with core reconstructed in an angle iron cradle.
- 2006 (TTR): 4 RCP holes at Flag for 882m, undertaken by Drillcorp utilising a 5 1/2-inch drill bit. Downhole surveys were taken with an Eastman survey camera.
- 2007 (TTR): 9 RCP holes across Kundip for 754m, undertaken by National Drilling utilising a 5 1/2inch drill bit. Downhole surveys were taken with an Eastman survey camera.
- 2008 (TTR): 8 DD's for 623.79m completed by ACM Drilling. Core diameter collared with HQ3 changing to NQ2 in competent rock. All core was orientated. 15 RCP holes including pre-collars to DDH's across Kundip for 1896.31m, undertaken by National Drilling utilising a 5 1/2-inch drill bit. Downhole surveys were taken with an Eastman survey camera. Diamond core was orientated using an EzyMark™ method with core reconstructed in an angle iron cradle.
- 2009 (TTR): 7 DD's for 559.2m, diameter HQ3 and NQ2, orientated core, undertaken by Sanderson Drilling. 82 RCP holes including three pre-collars to DDH's were completed across Kundip for 9687.4m, undertaken by Strange Drilling utilising a 5.375-inch drill bit. Downhole surveys were taken with an Eastman survey camera. Diamond core was orientated using an EzyMark™ method with core reconstructed in an angle iron cradle.
- 2010 (TTR): 16 DD's for 1264.4m, diameter HQ3 and NQ2, orientated core, undertaken by Sanderson Drilling. 58 RCP holes including eight pre-collars to DDH's were completed across Kundip for 9783.8m, undertaken by Strange Drilling utilising a 5.375-inch drill bit. Downhole surveys were taken with an Eastman survey camera. Diamond core was orientated using an EzyMark™ method with core reconstructed in an angle iron cradle.
- 2015 (SLR): 12 RCP holes for 1,143m, undertaken by Ausdrill using a 5 ½ inch drill bit. Downhole surveys were completed using a Reflex Gyro.
- In 2017 and 2018 Medallion completed 30 DDH's for 4,664.07m of PQ, HQ3 and NQ2, orientated core, undertaken by Westralian Diamond core drillers and Terra Drilling. Downhole surveys were taken with a both a REFLEX EZ-Shot and a North seeking GYRO by ABIMS surveying. In 2018 ACH also completed 37 RCP holes for 3,153m, including pre-collars to 2018 DD holes, and 78 AC holes for 3,745m. Diamond core was orientated using a Boart Longyear TruCore™ orientation system with core reconstructed in an angle iron cradle

Drill sample recovery	 Method of recording and assessing core and chip sample recoveries and results assessed. Measures taken to maximise sample recovery and ensure representative nature of the samples. Whether a relationship exists between sample recovery and grade and whether sample bias may have occurred due to preferential loss/gain of fine/coarse material. 	Not relevant to samples collected for metallurgical testwork.
Logging	 Whether core and chip samples have been geologically and geotechnically logged to a level of detail to support appropriate Mineral Resource estimation, mining studies and metallurgical studies. Whether logging is qualitative or quantitative in nature. Core (or costean, channel, etc) photography. The total length and percentage of the relevant intersections logged. 	 All diamond core drill core and reverse circulation rock chips have been geologically logged and transcribed to the Medallion logging scheme with a record kept of lithology, alteration, veining, mineralisation, sulphide content, weathering, grain size, colour, etc. Medallion believes this data to be of a level of detail adequate to support Mineral Resource estimation activities, mining and metallurgical studies. All RCP chips and diamond core drill cores post 2003 have been geologically logged for lithology, regolith, mineralisation, and alteration utilising Medallion's standard logging code library. RCP sample quality data recorded includes recovery, sample moisture (i.e. whether dry, moist, wet or water injected) and sampling methodology. Diamond core has also been logged for geological structure and geotechnical properties. Diamond core drill holes are routinely orientated, photographed both dry and wet and structurally logged with the confidence in the orientation recorded. Geotechnical data recorded includes QSI, RQD, matrix, and fracture categorisation.
Sub- sampling techniques and sample preparation	 If core, whether cut or sawn and whether quarter, half or all core taken. If non-core, whether riffled, tube sampled, rotary split, etc and whether sampled wet or dry. For all sample types, the nature, quality and appropriateness of the sample preparation technique. Quality control procedures adopted for all subsampling stages to maximise representivity of samples. Measures taken to ensure that the sampling is representative of the in-situ material collected, including for instance results for field duplicate/second-half sampling. Whether sample sizes are appropriate to the grain size of the material being sampled. 	 Post 2003, diamond core was cut using a diamond core saw and predominantly ½ core collected for analysis. Minor ¼ core sampling has occurred in selected DD holes that were used for metallurgical test work. In all TTR drill programmes (1997-2011), RCP samples in mineralised zones were riffle split at one-metre intervals. In barren zones spear samples were collected at 2-4m composites from the un-split portion of the sample using a 50mm PVC spear. If elevated metal values were reported from the composite samples the riffle split samples from those intervals were subsequently submitted for analysis. On rare occasions when samples were wet, the sample was collected by grab sampling by the site geologist. All drilling and sampling were completed under geological supervision. Samples at Kundip are a mixture of RCP, DD, AC, RAB and Vacuum. Predominantly only TTR/Medallion diamond core and RCP drilling post 1997 have been used for Mineral Resource estimation and metallurgical testwork at the Gem, Harbour View and Flag Deposits. For TTR/Medallion diamond core drilling the collection of ½ core for the majority of the drilling is deemed consistent. Core was logged by a qualified geoscientist and mineralised areas selected for sampling with sample lengths ranging between 0.3m to 1m. Each sub-sample is considered to be representative of the interval.

For TTR/Medallion RCP drilling, samples were split into 1m intervals directly off a rig-mounted splitter into pre-numbered calico bags and green bags. Samples were initially composite sampled on a two to four-metre basis using a 50mm PVC spear, whilst mineralised intervals were sampled on a 1m basis from the green bags and if they were anomalous in gold or copper, the 1m calico bag was submitted. Sample weights were typically 2 - 3 kg with minor samples >3 kg. Collected sample bags were placed in labelled and numbered plastic and/or polyweave bags for dispatch to assay laboratory. Quality of The nature, quality and appropriateness of the Between 1997-2010. TTR samples were submitted to Analabs/SGS Laboratory in Perth. assay data assaying and laboratory procedures used and whether the technique is considered partial or Element suite included, Au, Ag, Cu (±As, Co, Fe, and Mn, Pb, S, Zn). It is unknown what analytical laboratory techniques were used before 2003. From 2003 For geophysical tools, spectrometers, handheld tests XRF instruments, etc, the parameters used in onwards (when earliest metallurgical testwork determining the analysis including instrument samples were collected), analysis involved using make and model, reading times, calibrations a four-acid digest with a 50g fire assay (FA) aliquot factors applied and their derivation, etc. for gold and Atomic Absorption Spectrometry (AAS) finish for all elements. The acids used are Nature of quality control procedures adopted (e.g., hydrofluoric, nitric, perchloric and hydrochloric standards, blanks, duplicates, external laboratory acids, suitable for silica-based samples. checks) and whether acceptable levels of In 2011, AC and RCP samples were sent to Aurum accuracy (i.e., lack of bias) and precision have Laboratory in Perth and were analysed by Aqua been established. Regia for Au (AUAR50), Ag and Cu (AUARBM). Samples with Au values greater than 0.2ppm were subsequently analysed using 50g fire assay and Cu and Ag by AAS. In 2017, Medallion samples were submitted to ALS Laboratory in Perth. Element suite included Au, Ag, Cu, Fe and cyanide soluble Cu. Analytical techniques used a four-acid digest multi-element suite with fire assay and AAS finish for Au (50g) and inductively coupled plasma atomic emission spectroscopy (ICP/AES) finish for additional metals. Cyanide soluble Cu levels were analysed using a cyanide leach. The acids used are hydrofluoric, nitric, perchloric and hydrochloric acids, suitable for silica-based samples. Medallion also re-submitted 860 historic pulps from 2009-2010 TTR drilling to SGS for analysis of cyanide soluble Cu levels. Historic samples for drilling prior to 2003 have unknown laboratory procedures with Au analysed by fire assay with nominal AAS finish. Varying levels of Cu and Ag have also been analysed. In 2018 Medallion samples were submitted to SGS Laboratory in Perth for a 29 element suite. Samples underwent a four-acid digest with fire assay and AAS finish for Au (50g), ICP/OES finish for Al, Ca, Co, Cr, Cu, Fe, K, Mg, Mn, Na, Ni, P, Pb, S, Th, Ti, V, Zn and ICP-MS for Ag, As, Bi, Rb, Sc, Sr, Te, Tl, W, Zr. The acids used are hydrofluoric, nitric, perchloric and hydrochloric acids, suitable for silica-based samples. Standard chemical analyses were used for grade

determination. There was no reliance on determination of analysis by geophysical tools. Between 1997-2004 QC consisted of Laboratory

Internal Checks every 1:20 to check original pulp for analytical precision, laboratory repeats on a second pulp split to measure assay variability – typically on samples assaying greater than a specified value, and internal Laboratory Standards to measure analytical precision. A Maxwell Geoservices QAQCR report for copper and gold found no glaring concerns, although laboratory repeats on higher grade gold samples (typically > 10ppm or 10 g/t Au) exhibit far more scatter than the internal laboratory checks. This is to be expected as lab repeats are generally performed on results assaying higher than a specified value which may contain nuggetty or spotty gold.

- Between 2004-June 2010, QC procedures included the insertion of certified standards, blanks, and field duplicates. An external review of the database was competed by Cube Consulting in 2010 who reported that based on the limited data available, approximately 11% of QAQC control standards returned values outside the accepted limits for assessing the accuracy of the data. The majority of these erroneous samples are from copper analysis of uncertified blanks, where the assay values and standard deviations are not accurately known. The certified standards show that 8% of the samples exceed three (3) standard deviations but overall, no significant bias was detected that may indicate a material issue with the primary assays.
- In 2015 a total of 26 field duplicates were inserted at a rate of 1:21 with standards and blanks randomly inserted (every 1:24 and 1:41 samples respectively). No concerns were identified with the CRM's. Field duplicates were analysed for gold and copper. The gold values of duplicates showed poor repeatability with 15 outside the 10% accepted limits. Copper showed good repeatability with 80% of the repeats within 25% or less of the original value. As only gold repeatability was poor it is presumed that samples may contain nuggety or spotty gold.
- In 2017, Medallion submitted certified standards (4.1%) and blanks (3.6%) with duplicates (3.5%) rotary split from 2mm fine Boyd crusher at the laboratory. 3 blanks inserted after high-grade (>20 g/t Au) material showed contamination with no other bias detected that may indicate a material issue with the primary assays.
- In 2018, Medallion submitted certified standards (4.3%) and blanks (1%) with field duplicates selected from Resource Definition RCP and DD (1.3%). 90% of field duplicates consisted of ¼ core samples very closely adjacent to the original quarter-core sample. The remaining samples were RCP riffle splits from the original RCP rig cone splitter reject. Duplicate repeats on higher grade gold samples (typically > 5ppm or 5 g/t Au) exhibit far more scatter than the lower grade samples which displayed good repeatability. Copper and silver repeats display excellent repeatability. CRM's including blanks overall



Vaviliantian	The verificati	ion of eignificant interpolations by		performed well with no significant bias detected that would indicate a material issue with the primary assays.
Verification of sampling and assaying	 either indep personnel. The use of tw Documentation procedures, (physical and 	ion of significant intersections by endent or alternative company inned drillholes. In of primary data, data entry data verification, data storage electronic) protocols.	,	Not relevant to samples collected for metallurgical testwork.
Location of data points	drillholes (c trenches, min in Mineral Res Specification Quality and a	I quality of surveys used to locate ollar and down-hole surveys), e workings and other locations used source estimation. of the grid system used. dequacy of topographic control.		A qualified surveyor picked up collar locations for drilling between 1975-2003 using a theodolite. A Trimble RTX GPS was used between 2002-2007 to pick up collars. Accuracy is ±5cm for easting, northing and elevation. Drill hole collars between 2007-2010 were picked up using a DGPS. Accuracy is ±1m for easting, northing and elevation. Between 1996 - 2011, all downhole surveys were completed with either an Eastman single-shot camera or Reflex EZ-SHOT on nominal 30m intervals. A minor percentage of the drill holes have deviation from the initial azimuth which is believed to be the effects of pyrrhotite within massive sulphides within the ore zone. The reliability of the historical downhole surveying is considered average. In 2015, SLR completed downhole surveying using a Reflex Gyro. Medallion in 2017 used a Reflex EZ-SHOT and in 2018 a North seeking Gyro was used by ABIM Solutions.
Data spacing and distribution	Whether the sufficient to es grade contin Resource a procedure(s)	for reporting of Exploration Results. data spacing, and distribution is stablish the degree of geological and uity appropriate for the Minera and Ore Reserve estimation and classifications applied. ple compositing has been applied.		Not relevant to samples collected for metallurgical testwork.
Orientation of data in relation to geological structure	unbiased same extent to who deposit type. If the relation and the orient considered to this should be	orientation of sampling achieves appling of possible structures and the ich this is known, considering the ship between the drilling orientation ation of key mineralised structures is have introduced a sampling bias, assessed and reported if material.		Not relevant to samples collected for metallurgical testwork.
Sample security		s taken to ensure sample security.	•	Not relevant to samples collected for metallurgical testwork.
Audits or reviews	 The results o techniques ar 	f any audits or reviews of sampling nd data.	•	No external audits or reviews have been undertaken.

Section 2, Reporting of Exploration Results

Criteria	JORC Code explanation	Commentary
Mineral	 Type, reference name/number, location and ownership including agreements or material 	
tenement and land tenure	issues with third parties such as joint ventures,	74/51.
status	partnerships, overriding royalties, native title interests, historical sites, wilderness or national	

	nark and anvironmental cottings	There are no known haritage as assistance at
	 park and environmental settings. The security of the tenure held at the time of reporting along with any known impediments to obtaining a licence to operate in the area. 	 There are no known heritage or environmental impediments to development over the leases. The tenements are in good standing with the Western Australian Department of Mines, Industry Regulation and Safety. No known impediments exist to operate in the area.
Exploration done by other parties	Acknowledgment and appraisal of exploration by other parties.	 Historical exploration, underground and open pit mining has been carried out at Kundip by various parties between 1901 and 2020. Modern exploration, consisting mainly of mapping, sampling, and surface drilling, has been carried out by; Union Minière – Hollandia JV (1975-1979) Norseman Gold Mines (1979-1991) with Newmont JV (1979) Glengold Holdings. (19911994) Tectonic Resources (1994 -1996) Tectonic Resources and Homestake Gold of Australia (Barrick) JV (1996 - 2003) Tectonic Resources (2003-2012) Silver Lake Resource (2012-2016) Medallion Metals Ltd (2016-present)
Geology	Deposit type, geological setting and style of mineralisation.	• Mineralisation at Kundip is shear-hosted gold-copper within the Archaean Annabelle Volcanics consisting of andesitic to dacitic volcaniclastics and lavas. Primary mineralisation is hosted in three main vein sets, the Flag, Harbour View, and Gem Lodes. The main ore lodes are narrow, subparallel, quartz-sulphide veins. The Flag and Gem series lodes have a stacked en echelon architecture, strike approximately east-west dip, and moderately between 35°-60° to the south. The Harbour View main lodes strike ≈020° and dip steeply to subvertical (75°-85°) to the WNW.
Drillhole Information	 A summary of all information material to the understanding of the exploration results including a tabulation of the following information for all Material drillholes: easting and northing of the drillhole collar elevation or RL (Reduced Level – elevation above sea level in metres) of the drillhole collar dip and azimuth of the hole down hole length and interception depth hole length. If the exclusion of this information is justified on the basis that the information is not Material and this exclusion does not detract from the understanding of the report, the Competent Person should clearly explain why this is the case. 	 Drill hole location and directional information is provided within the body of the report and within Annexure 1. All RCP and DDH drill collars are included in the plan view map.
Data aggregation methods	 In reporting Exploration Results, weighting averaging techniques, maximum and/or minimum grade truncations (e.g., cutting of high grades) and cut-off grades are usually Material and should be stated. Where aggregate intercepts incorporate short lengths of high-grade results and longer 	Not relevant to samples collected for metallurgical testwork.

	 lengths of low-grade results, the procedure used for such aggregation should be stated and some typical examples of such aggregations should be shown in detail. The assumptions used for any reporting of metal equivalent values should be clearly stated 	
Relationship between mineralisation widths and intercept lengths	 These relationships are particularly important in the reporting of Exploration Results. If the geometry of the mineralisation with respect to the drillhole angle is known, its nature should be reported. If it is not known and only the down hole lengths are reported, there should be a clear statement to this effect (e.g., 'down hole length, true width not known'). 	Not relevant to samples collected for metallurgical testwork.
Diagrams	Appropriate maps and sections (with scales) and tabulations of intercepts should be included for any significant discovery being reported. These should include, but not be limited to a plan view of the drillhole collar locations and appropriate sectional views.	Not relevant to samples collected for metallurgical testwork.
Balanced reporting	Where comprehensive reporting of all Exploration Results is not practicable, representative reporting of both low and high grades and/or widths should be practiced to avoid misleading reporting of Exploration Results.	 Due to the large number of results, mean, median, maximum and minimum values are presented for each key area of reporting. No comment is made as to the ability to replicate the results at scale in an operational setting. The report is considered balanced and in context.
Other substantive exploration data	Other exploration data, if meaningful and material, should be reported including (but not limited to): geological observations; geophysical survey results; geochemical survey results; bulk samples – size and method of treatment; metallurgical test results; bulk density, groundwater, geotechnical and rock characteristics; potential deleterious or contaminating substances.	Not relevant to samples collected for metallurgical testwork.
Further work	 The nature and scale of planned further work (e.g., tests for lateral extensions or depth extensions or large-scale step-out drilling). Diagrams clearly highlighting the areas of possible extensions, including the main geological interpretations and future drilling areas, provided this information is not commercially sensitive. 	 Medallion is in the process of conducting a 45,000m RCP and DD drill programme at RGP during 2021 and 2022. Drilling is primarily for resource extension and definition purposes however remnant sample will be preserved for future metallurgical testwork. Additional metallurgical testwork is expected to be undertaken in 2022-23 to support further feasibility studies of the Ravensthorpe Gold Project.